

TECHNICAL SERVICE BULLETIN

1" Automatic Diesel Nozzle Thread Leaks

SUBJECT

Intermittent tolerance variance on inlet thread of nozzle may result in leaking at hose connection when the nozzle is installed without the use of a pipe thread sealant paste. Nozzles reported with this issue have been evaluated by GPI. The threads of the nozzles were checked with gauges, and it was discovered that we had received nozzles with BSPT threads from our supplier.

MODELS AFFECTED

1" Auto Diesel Nozzles starting January 2023 to November 2023.

REMEDY

GPI has adjusted the tolerance specifications of the nozzle inlet port (see Figure 1) to improve thread engagement with hose end fittings at this connection point.

ACTION

Contact GPI and request a Return Material Authorization (RMA) to return any leaking nozzles to GPI for evaluation. GPI will ship out replacement nozzles free of charge.

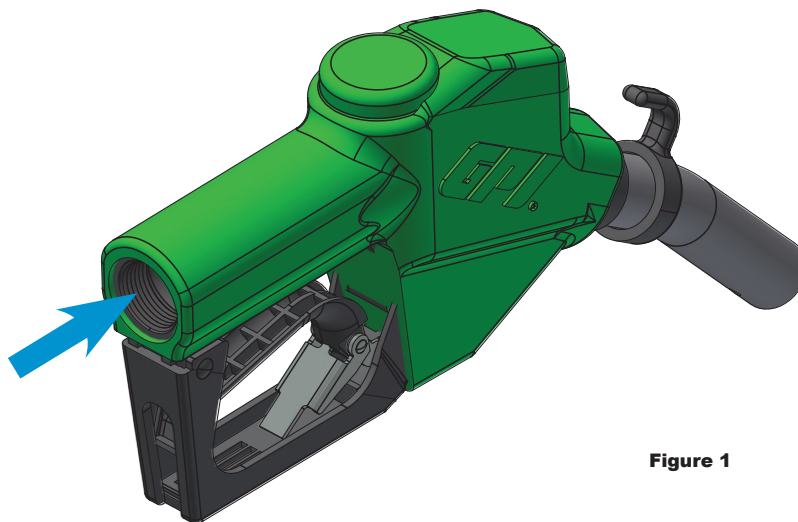


Figure 1